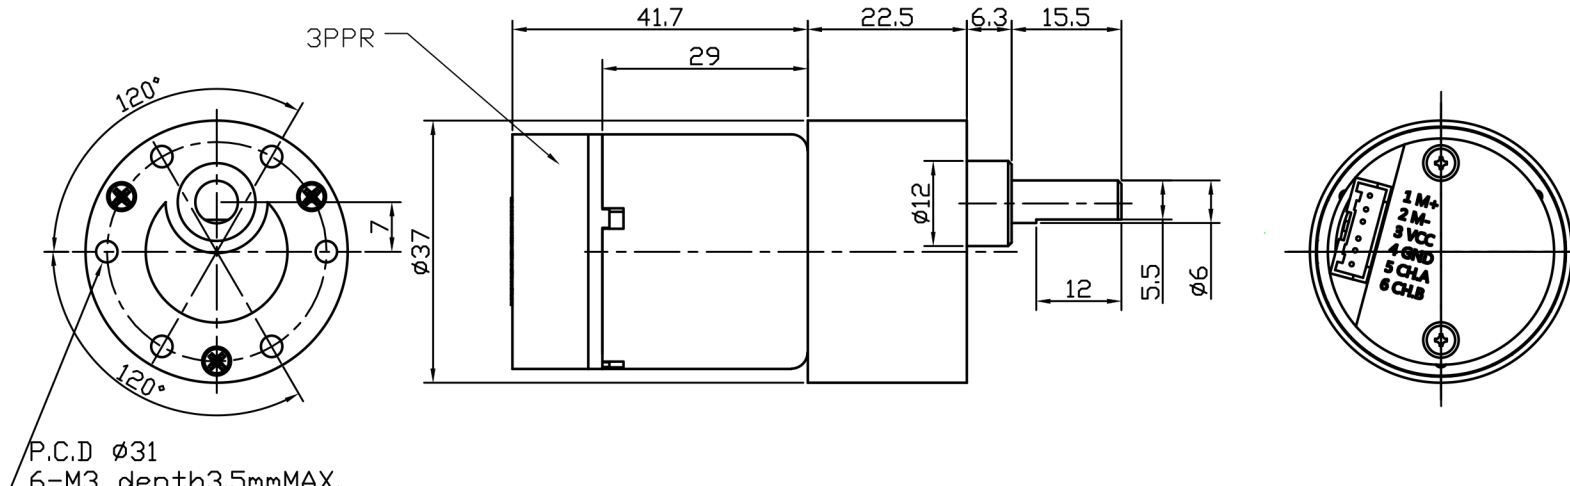


图号 (Drawing NO.)		SG01 (30KAR) -5Y006B-000		型号 (Model No.)		SPG30E-30K		电压 (Voltage)			
图纸 Drawing:		版次: 1.0		 <p>P.C.D Ø31 6-M3 depth3.5mmMAX.</p>							
		客户确认 (Customer APP.):									
		参数 Details:		减速电机参数 (Geared motor specification):				注意事项 (Notes):			
空载电流 (No Load Current) (mA):				≤ 100		<p>1, 焊接作业请在短时间内实行。(推荐: 焊接头的温度340~400度, 2秒内实行) Please conduct the welding work in a short time.(Recommendation: With the soldering iron tip at a temperature of 340~400℃, within 2 seconds</p> <p>2, 在安装过程中不应使减速电机受到冲击、跌落。不允许直接在减速器出轴上敲打或压配。Prevent gear motor from being shocked or dropping in mounting process.It is prohibited to strike and crush directly on reducer output shaft.</p> <p>3, 安装螺丝请前先确认外观图所标示之形式及长度尺寸。Install the screws after first checking the taps and tap depth against the dimensions entered on the exterior drawing.</p> <p>4, 请小心使用, 勿使黏接剂借由输出轴流入轴内。 It is necessary to be careful that the adhesive does not spread along the shaft and flow into the bearing.</p> <p>5, 请不要在安装零件时为了调整位置而从输出轴方向去回转齿轮马达。Do not turn a geared motor by its output shaft when,for example,arranging its position so as to install it.</p>					
空载转速 (No Load Speed) (r. p. m):				150 ± 15							
额定力矩 (Rated Load Torque) (kgf. cm):				1.80							
额定电流 (Rated Current) (mA):				≤ 600							
额定转速 (Rated Load Speed) (r. p. m):				112 ± 12							
堵转电流 (Stall Current) (mA):											
堵转力矩 (Stall Torque) (kgf. cm):											
旋转方向 (Rotation Direction):		CW/CCW									
备注 (Remarks):											
Draw:				Rev:				App.:			